


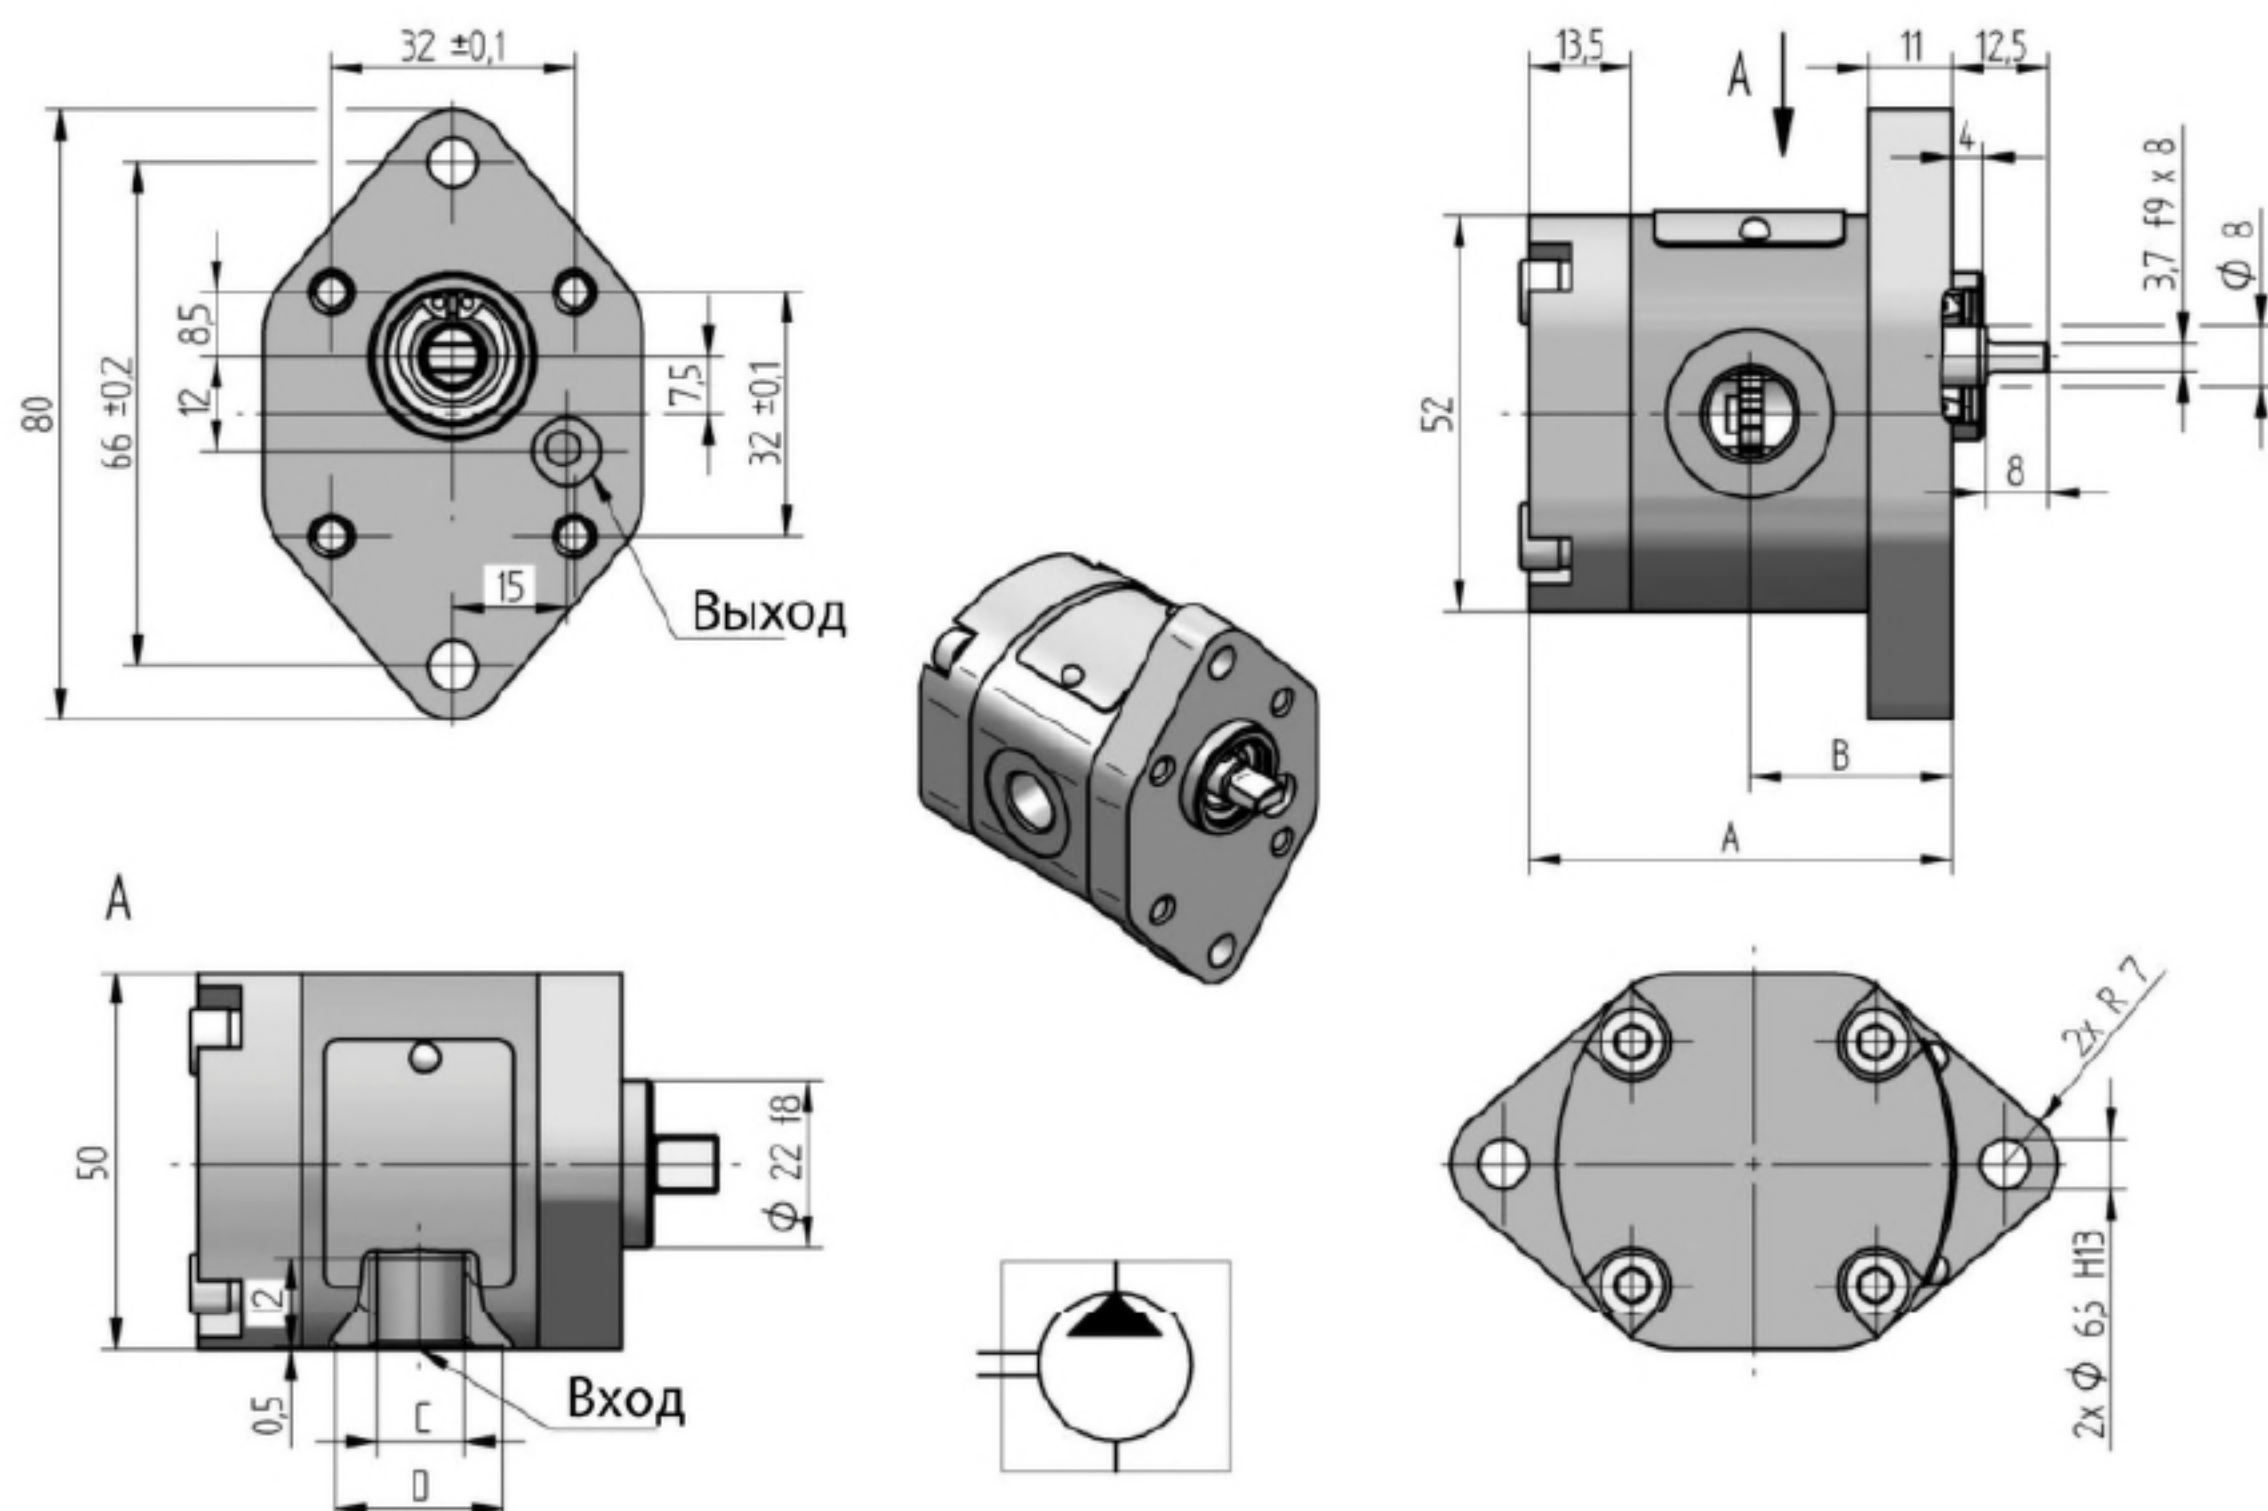

X-3,20R-R01K02-CG01P01-N		R	3,2	60	500	1 800	80	38,8	G 1/4	Ø 22		
X-3,20L-R01K02-CG01P01-N		L										
X-2,50R-R01K02-CG01P01-N		R	2,5	90	500	2 500	74,1	35,8	G 1/4	Ø 22		
X-2,50L-R01K02-CG01P01-N		L										
X-2,00R-R01K02-CG01P01-N		R	2	120	600	2 800	69,8	33,7	G 1/4	Ø 22		
X-2,00L-R01K02-CG01P01-N		L										
X-1,50R-R01K02-CG01P01-N		R	1,5	160	800	3 000	65,6	31,6	G 1/4	Ø 22		
X-1,50L-R01K02-CG01P01-N		L										
X-1,25R-R01K02-CG01P01-N		R	1,25	200	800	4 000	63,4	30,5	G 1/4	Ø 22		
X-1,25L-R01K02-CG01P01-N		L										
X-1,00R-R01K02-CG01P01-N		R	1	200	800	5 000	61,2	29,4	G 1/4	Ø 22		
X-1,00L-R01K02-CG01P01-N		L										
X-0,80R-R01K02-CG01P01-N	180 9950	R	0,8	220	1 000	6 000	59,5	28,5	G 1/4	Ø 22		
X-0,80L-R01K02-CG01P01-N		L										
X-0,70R-R01K02-CG01P01-N		R	0,7	220	1 000	6 000	58,7	28,1	G 1/4	Ø 22		
X-0,70L-R01K02-CG01P01-N		L										
X-0,63R-R01K02-CG01P01-N		R	0,63	220	1 000	6 000	58	27,8	G 1/4	Ø 22		
X-0,63L-R01K02-CG01P01-N		L										
X-0,50R-R01K02-CG01P01-N		R	0,5	230	1 000	6 000	56,9	27,2	G 1/4	Ø 22		
X-0,50L-R01K02-CG01P01-N		L										
X-0,40R-R01K02-CG01P01-N		R	0,4	230	1 000	7 000	56,1	26,8	G 1/4	Ø 22		
X-0,40L-R01K02-CG01P01-N		L										
X-0,36R-R01K02-CG01P01-N		R	0,36	230	1 000	7 000	55,7	26,6	G 1/4	Ø 22		
X-0,36L-R01K02-CG01P01-N		L										
X-0,32R-R01K02-CG01P01-N	180 9949	R	0,32	230	1 000	7 000	55,4	26,5	G 1/4	Ø 22		
X-0,32L-R01K02-CG01P01-N		L										
X-0,25R-R01K02-CG01P01-N		R	0,25	230	1 000	7 000	54,8	26,2	G 1/4	Ø 22		
X-0,25L-R01K02-CG01P01-N		L										
X-0,18R-R01K02-CG01P01-N		R	0,18	200	1 000	8 000	54,1	25,8	G 1/4	Ø 22		
X-0,18L-R01K02-CG01P01-N		L										
Шифратор серии	Артик ул	Нап рав вра щен	Объем [см³/об]	Ном. давлен. [бар]	Мин. Обороты [мин⁻¹]	Макс.	A	B	C	D	E	F